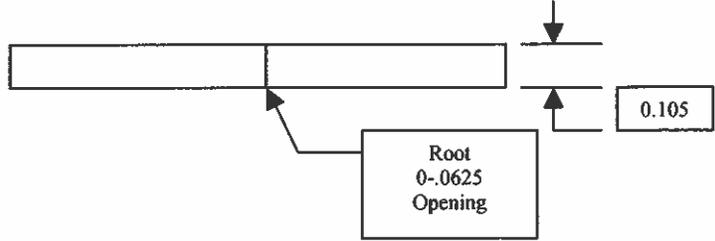


Welding Procedure Specification

Welding Procedure Specification No.: <i>Fermi WPS SS-9-001</i>		Date: <i>1/15/2010</i>	
Revision No.:	Revision Date:	Remarks:	Supporting PQR No.(s): <i>Fermi PQR SS-9-001</i>
Welding Processes: (1)Type: <i>GTAW/Manual</i> (2)Type:			
<small>(Manual, Automatic, Machine, Semi-automatic)</small>			

Joints (QW-402):			
Joint Design: <i>Square Butt Groove</i>	Backing: <i>Gas</i>	Backing Material (Type) Root: <i>Argon Gas</i>	Remainder:
Retainer: <i>Yes *** No</i>	Type: <i>Non-Metallic *** Metallic (Non fusing)</i>		
Joint Details: Groove Weld			
SA 240 .105 plate, ER 308/308L F6 Filler			
			

Base Metals (QW403):	P-No.: <i>8, Group 1</i>	To	P-No.: <i>8, Group 1</i>
Specification Type and Grade:	<i>SA 240 Type 304</i>		
TO Specification Type and Grade:	<i>SA 240 Type 304</i>		
OR Chemical Analysis and Mechanical Properties:			
TO Chemical Analysis and Mechanical properties:			
Thickness Range:	Process 1		Process 2
Base Metal:	Groove: <i>.105"-.210"</i>	Fillet: <i>Unlimited</i>	Groove: Fillet:
Deposited Weld Metal:	Groove: <i>.062"-.210"</i>	Fillet: <i>Unlimited</i>	Groove: Fillet:
Pipe Diameter Range:	Groove: <i>2.875" Min.</i>	Fillet: <i>Unlimited</i>	Groove: Fillet:
Other:			

Filler Metals (QW-404)	Process 1		Process 2	
Specification No. (SFA):	<i>SFA5.9</i>			
AWS No, (Class):	<i>ER 308/308L</i>			
F-No.:	<i>F6</i>			
A No.:	<i>8</i>			
Size of Filler Metals:	<i>.035-.0625</i>			
Deposited Weld Metal Thickness Range:	Groove: <i>.062-.210</i>	Fillet: <i>Unlimited</i>	Groove: Fillet:	
Electrode-Flux (Class):				
Flux Trade Name:				
Consumable Insert:				
Other:				

Each Base Metal-Filler Metal Combination should be recorded individually

Use of Fermilab Welding Procedures and Welder Qualifications for non-Fermilab work shall be at the sole risk and responsibility of the Subcontractor, and the Subcontractor shall indemnify and save Fermilab and the government harmless from any and all claims, demands, actions or causes of action, and for any expense or loss by reason of Subcontractor's and their employees possession and use of Fermilab procedures and qualifications.

Welding Procedure Specification

Positions (QW-405)		Post Heat Treatment (QW-407)	
Positions of Groove:	IG	Temperature Range:	None
Welding Progression	N/A	Time Range	N/A
Positions of Fillet	IF		

Preheat (QW-408)		Gas (QW-408)			
Preheat Temperature:	Minimum 50 °F			% Composition	
Interpass Temperature:	Maximum-Not Recorded		Gases	Mixture	Flow Rate
Preheat Maintenance:	None	Shielding	Argon	99.9%	15-20CFH
Minimum Welding Temperature	32 °F	Trailing	None	***	***
		Backing	Argon	99.9%	15-20 CFH

Electrical Characteristics (QW-409)				
Current – AC or DC:	Direct Current	Polarity: Straight	Characteristics:	Non-Pulsing
Tungsten Electrode:	Size: 3/32 Ø	EWTh-2		
Mode of Metal Transfer for GMAW:	N/A			
Electrode Wire Feed Speed Range:	N/A			

Technique (QW-410)	
String or Weave Bead:	String
Orifice or Gas Cup Size:	#5 or #6 Gas Lens
Initial Interpass Cleaning (Brushing, Grinding, etc.):	Initial, Solvent Clean
Method of Back Gouging:	None
Oscillation:	None
Contact Tube to Work Distance:	N/A
Multiple or Single Pass (per side):	Single
Multiple or Single Electrode(s):	Single
Travel Speed (Range):	As Required
Peening:	None
Other:	

Sequence Chart:								
Weld Layers	Processes	Filler Metal		Current		Voltage Range	Travel Speed Range	Other (Power Source) (Special Requirement)
		Class	Ø	Type Polarity	Amperage Range			
1 Final	GTAW	ER 308/308L	3/32"	DCEN	83-85	13.5	As Required	Miller Dynasty #4173

Use of Fermilab Welding Procedures and Welder Qualifications for non-Fermilab work shall be at the sole risk and responsibility of the Subcontractor, and the Subcontractor shall indemnify and save Fermilab and the government harmless from any and all claims, demands, actions or causes of action, and for any expense or loss by reason of Subcontractor's and their employees possession and use of Fermilab procedures and qualifications.